

## Release Note for Vigor120 Series

**Firmware Version: 3.2.4.4**  
**Built Date: September 06, 2010**  
**Applied Models:**  
**Vigor120**

---

- File and Modem Code

(1)For Annex A Model,

- "v120\_a\_v3244" is used for modem code 321311. (Standard)
- "v120\_a1\_v3244" is used for modem code 310801.
- "v120\_a2\_v3244" is used for modem code 310811.
- "v120\_a3\_v3244" is used for modem code 3211201
- "v120\_a4\_v3244" is used for modem code 332201.
- "v120\_a5\_v3244" is used for modem code 343601.
- "v120\_a6\_v3244" is used for modem code 343701 (recommended for Italy).
- "v120\_a7\_v3244" is used for modem code 3431301.
- "v120\_a8\_v3244" is used for modem code 344001.
- "v120\_a9\_v3244" is used for modem code 344101.

(2)For Annex B Model,

- "v12x\_b\_v3244" is used for modem code 311112. (Standard)
- "v12x\_b1\_v3244" is used for modem code 3101212.
- "v12x\_b2\_v3244" is used for modem code 3101332.
- "v12x\_b3\_v3244" is used for modem code 311102.
- "v12x\_b4\_v3244" is used for modem code 346302.

## New Features

- Be able to change TR-069 CPE Client username and password.

## Improvement

- Corrected: Vigor router acts as a DHCP client and sends the DHCP packets with the same DHCP transaction ID to DHCP server.
- Corrected: Save problem occurs for **Interval Time of Periodic Inform Settings** in

### **System Maintenance>>TR-069.**

- Corrected: TR-069 service doesn't work when ACS Server URL sets HTTPS URL without port number configured.
- Corrected: May meet reboot problem when type "*ip igmp\_proxy status*" command.
- Corrected: 1483 routed mode can not work on PVC WAN3/4/5.
- Corrected: Crash occurred when TR-069 session is timeout.
- Corrected: ADSL TX throughput can not exceed 1Mbps while ADSL link is on Annex M mode.
- Improved: ADSL link problem.
- Improved: Let HTTP Host header to use domain or IP address according to ACS URL setting.

## **Known Issue**

- None

## **Notes**

### ***Modifications***

- None