

## Release Note for Vigor2110 Series

**Firmware Version: 3.3.5**  
**Built Date: August, 4, 2010**  
**Applied Models:**  
**Vigor2110, Vigor2110n, Vigor2110Vn**

---

Please ensure you download and use the latest router tools when upgrading the firmware.

### New Features

- Support T.38 function
- Support Web Content Filter (WCF, Commtouch solution and BPjM solution)
- Support USB disk file explore on WUI
- Support MX Type DNS Query
- Support FSK caller ID detection
- Support DTMF caller-ID format

### Improvement

- Corrected: Tone setting problem (for Italy) in the **VoIP>>Phone Settings>>Advanced Settings** page.
- Corrected: Setting problem on Codecs in **VoIP >> Phone Settings** page.
- Corrected: Might get reboot problem while doing some unusual calls.
- Corrected: Might get reboot problem while doing Call Transfer service.
- Corrected: WLAN LED will be on still even WLAN function is off by schedule setting.
- Corrected: PPTP passthrough can not work.
- Corrected: Save problem occurred for **Interval Time of Periodic Inform Settings** in **System Maintenance>>TR-069**.
- Corrected: Crash occurred when TR-069 session is timeout.
- Corrected: HTTPS URL (without port) setting in ACS Server URL for TR-069 function doesn't work.
- Corrected: Page error while setting service name or comment with '\' in **NAT >> Port Redirection** or **NAT >>Open Ports** page.
- Corrected: A reboot problem occurs while doing call transfer with Netherlands SIP account.
- Corrected: Connection or reboot problem might occur while enabling ping detect host

with 3G backup.

- Corrected: Certificate may not be sent out while sending **Cert Request** in **inR2\_outR3** or some remote sites like cisco pix.
- Corrected: Fixed the problem that PPTP tunnel exists but always gets protocol rejected from the peer.
- Corrected: IP trace route and IP ping carry wrong source IP addresses when using PPTP/L2TP WAN, but the destination IP is set in the static route.
- Corrected: When VPN server is behind Vigor NAT and True IP DMZ is used to get IP, Vigor NAT will block both VPN client's and VPN server's GRE request.
- Improved: Modify "Static or Dynamic IP (DHCP client)" to "Static or Dynamic IP" on MPoA page.
- Improved: Troubles in 3G modem of HuaWei E1762/E1550 IOP.
- Improved: Show warning message after logging in with wrong user name or password.
- Improved: A problem occurred that different Drayteker DHCP servers will use the same transaction ID.
- Improved: Modified the telnet command (*arp cache table*) for deleting the ARP entry, from 180 seconds to 40 seconds once ARP cache entry is expired.
- Improved: Reword the "*ip arp setCacheLife*" command.
- Improved: Web page for Hardware Acceleration has been removed due to auto detection by Vigor router.

## Known Issue

- None

## Notes

### ***Modifications***

- None