

Release Note for Vigor2710 Series

Firmware Version: 3.3.0

Built Date: August 05, 2009

Applied Models:

Vigor2710, Vigor2710n, Vigor2710Vn, Vigor2710VDn

- File and Modem Code
 - (1)For Annex A Model,
 - " v2710_a_330" is used for modem code 211801. (Standard)
 - " v2710_a1_330" is used for modem code 211011.
 - " v2710_a2_330" is used for modem code 2121501.
 - " v2710_a3_330" is used for modem code 2211201.
 - (2)For Annex B Model,
 - " v2710_b_330" is used for modem code 2111112. (Standard)
 - " v2710_b1_330" is used for modem code 2111302.
 - " v2710_b2_330" is used for modem code 2121302.
 - " v2710_b4_330" is used for modem code 214702.
 - " v2710_b5_330" is used for modem code 2111312.
 - " v2710_b6_330" is used for modem code 215202.

New Features

- Support DECT feature for Vigor2710VDn
- Support 3G backup feature (not applicable to users in UK)
- Upgrade VoIP driver for improvement.
- Add/modify signatures to block new version PPStream.
- Add/modify signatures to block new version UUSee.
- Add syslog when packets dropped by QoS.
- Add QoS telnet command.
- Add telnet command to receive illegal ARP REPLY packet (Ethernet source address doesn't match ARP sender address).
- Add SIP Account setting item in user mode.
- Add "Select All" button in IM object page, P2P Object page, Protocol Object page, Misc Object page.
- Add "Loop Through To PSTN" in VoIP Status on WUI.

Improvement

- Corrected: Got error message while running firmware upgrade on Firefox 3.0.3.
- Corrected: Meet connection problem while running P2P service & enabling session limit.
- Change Wireless MAC Address to upper case on WUI.
- Corrected: DDNS send request error.
- Corrected: DDNS Auto-Update interval value can't be cleared or set to factory default value.
- Corrected: A problem of DHCP MaxAddress Provision for TR069.
- Corrected: A problem of ProvisionKeepParameter crash for TR069.
- Corrected: Set WPS client's default MAC address as 00-00-00-00-00-00 to avoid WUI display error.
- Corrected: QoS queue may stop to process packets.
- Corrected: CPA query timeout problem will be occurred while DMZ host enabled.
- Corrected: Lose 'G.DMT' item in PPPoE / PPPoA>>DSL Modem Settings.
- Corrected: DMZ alert problem happened on WUI.
- Corrected: WAN IP Alias cannot be cleared on WUI.
- Corrected: 'Schedule' relatively contents is hidden in user mode.
- Corrected: Display error for WCF LED.
- Corrected: WLAN Advanced Setting\WMM Configuration is hidden in user mode.
- Corrected: Auto-detect function submit error "404 Not Found" in Quick Start Wizard.
- Corrected: Can't clear old configuration when upgrade *.RST firmware by WUI Firmware Upgrade page.
- Corrected: SSID can't set " " word problem.
- Corrected: Login problem with IE8.
- Corrected: IKE phase 1 proposals are incomplete.
- Corrected: PPTP WAN connection cannot dial out because of sending GRE encapsulated TCP packet to server.
- Corrected: When PPTP WAN connection established, the router can not access LAN that it belong to.
- Corrected: Wireless clients can access Web UI in isolated LAN mode when they use 2nd subnet IP or changed HTTP, HTTPS, SSH, TELNET, FTP port.
- Corrected: DTMF tone has a loud voice when automatically redials to PSTN line.
- Corrected: Display problem for the ring port configured in **VoIP>>SIP Account**.
- Corrected: Only one phone can loop through to PSTN at the same time for FXS software relay and hardware relay.
- Corrected: No difference found when selecting a new ring pattern.
- Corrected: Can't register multiple SIP accounts on VoIP page for some ISP.
- Corrected: Display error for VoIP LEDs (Phone 1 and Phone 2) in some situations.

Known Issue

- None

Notes

Modifications

- None