

## Release Note for Vigor2710 Series

**Firmware Version: 3.3.2**

**Built Date: November 27, 2009**

**Applied Models:**

**Vigor2710, Vigor2710n, Vigor2710Vn, Vigor2710VDn**

---

- File and Modem Code

(1)For Annex A Model,

- " v2710\_a\_332" is used for modem code 211011. (Standard)
- " v2710\_a1\_332" is used for modem code 211801.
- " v2710\_a2\_332" is used for modem code 2121501.
- " v2710\_a3\_332" is used for modem code 2211201.
- " v2710\_a4\_332" is used for modem code 232201. (Recommended for UK – SEG)

(2)For Annex B Model,

- " v2710\_b\_332" is used for modem code 2111112. (Standard)
- " v2710\_b1\_332" is used for modem code 2111302. (Recommended for Attel Czech only)
- " v2710\_b2\_332" is used for modem code 2121302.
- " v2710\_b4\_332" is used for modem code 214702.
- " v2710\_b5\_332" is used for modem code 2111312.
- " v2710\_b6\_332" is used for modem code 215202.

## New Features

- Support USB Disk Application (FTP/Samba).
- “twodns” DDNS service.
- Support PPPoA pass-through function.
- Show source MAC address on Syslog for LAN to WAN packets.
- Support Sierra 597 USB 3G Modem.
- Add value for VPI/VCI (2/40) to Auto Detection table for Norway.

## Improvement

- Corrected: DTMF can't be detected when a DECT phone redials to PSTN phone.
- Corrected: Dial Out Account can not be set to default on DialPlan Setup of WUI.

- Corrected: If the phone is disabled but the phone state is not changed, the phone will not ring when receiving PSTN incoming call.
- Corrected: When RFC-2833 with payload type= 96 packet is received, the router will reboot.
- Corrected: SIP memory leakage.
- Corrected: Problem of DECT phone ring after enabling the call barring block IP address.
- Corrected: Call transfer failed for DECT phone.
- Corrected: Problem of setting DECT play dial tone only when the account has been registered.
- Corrected: Problem for semi-attendent CT for VoIP.
- Corrected: Can not save DSL settings sometimes after finishing Auto Detection in Quick Start Wizard.
- Corrected: Some problems occurred on WUI.
- Corrected: Can not get TR069 parameters after meeting TR069 connection timeout.
- Corrected: Firmware upgrade may be failed when upgraded by TR069.
- Corrected: UCF can save 12 objects, only.
- Corrected: Call filter malfunctioning.
- Corrected: Failure of running IP Ping through PPTP of VPN.
- Corrected: Problem of L2TP over IPsec for teleworker.
- Corrected: Adding UPNP port mapping failed.
- Corrected: Connection problem on PPTP NAT pass-through.
- Improved: Prevent users from dialing 37-39 or 57-59 to DECT phone.
- Improved: Wildcard '?' can be used in Digit Map.
- Improved: Allowed VoIP number starting with # for non-IP calls.
- Improved: Wireless interoperability with Vigor AP700 while using WDS with WPA or WPA2 mode.
- Improved: Mouse cursor stays on the field of Username in Login page of Web UI.
- Improved: Add/modify some TR069 parameters.
- Improved: Router stability against NMAP scan.
- Improved: Bridge mode may not work after powering off/on.
- Improved: Add/modify some IM/P2P signatures.
- Improved: Modify QoS command for usage and message display.
- Improved: Remain ARP cache life settings to flash even reboot the router.
- Improved: Increase compatibility with more stun servers.

## Known Issue

- None

# Notes

## *Modifications*

- None