

Release Note for VigorPhone 350

Firmware Version: 12202.26.1.10

Built Date: June 29, 2012

**Applied Models:
VigorPhone 350**

VigorPhone enables you to make phone calls through the IP network instead of calling through a traditional local PSTN line.

It is workable with VigorIPPBX series for auto-provision capability. To manage various calling purposes, VigorPhone supports multi-SIP registration with different accounts (up to 10) and support G.722 codec for promoting voice quality. The simple WEB UI based configuration allows you to operate VigorPhone with ease.

New Features

- Users can configure the BLF button to support Line3 and Line4.

Improvement

- Fixed: A compatibility problem occurs when the users login the WUI by Google Chrome.
- Fixed: An extension number has been registered to VigorIPPBX3510 with PPTP. When there is a phone call coming from SIP Trunks and is forwarded to VigorPhone350, both sides cannot hear any voice.
- Fixed: A noise occurs when a call is on hold with DrayTek Soft Phone.
- Fixed: Compatibility problem occurs in Internet Explorer 9.
- Fixed: When there is an incoming call from SIP Trunk, DTMF cannot be detected if someone dials the extension number.
- Fixed: Dialing to Hunt Group by using Vigor ATA-24, such call cannot be transferred by IP Phone350.
- Fixed: When dialing the Voice Mail button with G729 only, the message of "please enter your password" is distorted.
- Fixed: After restarting the second SIP registration and rebooting the device again., the second account will be erased immediately.
- Improved: When there is a phone call coming from SIP Trunk, only the Caller Number will be displayed but not Trunk number.
- Improved: Support Un-Attendant call transfer function.
- Improved: The calendar function supports German language.

- Improved: Sporadic voice delay issue.
- Improved: Answered calls list shows only the own number.
- Improved: VigorPhone 350 cannot ring after the server sends the invite with MIME-Version: 1.0 in message header.
- Improved: VigorPhone 350 is unable to identify Subscription-State “*terminated; reason=timeout*” when changing memory key function from BLF to Speed Dial.

Known Issue

- Upgrading VigorPhone 350 to firmware version 12202.26.1.10 will cause device configuration back to default settings. Please backup the System Configuration before upgrading to 12202.26.1.10 and restore the file after the device successfully upgraded to 12202.26.1.10.
- The old configuration file (earlier than 12202.26.1.07) is not compatible with the new firmware.

Notes

- If the firmware of the device is 12202.26.1.07 or earlier, please follow the steps as below to upgrade the firmware,
 Step1: 12202.26.1.07H_1FULL.img (via TFTP) (upgrade boot loader)
 Step2: 12202.26.1.10_FULLL.img (via TFTP) (upgrade firmware)
- If the firmware of the device is 12202.26.1.07H, please upgrade from Web directly:
 Step1: 12202.26.1.10.img (via Web) (upgrade firmware)

Modifications

- None

Bug Lists

- None