

## Release Note for VigorSwitch PX2060

Firmware Version:	2.9.10
Loader Version:	3.5.5
Release Type:	Regular – Upgrade recommended when convenient, as it includes general improvements and optimizations
Applied Models:	VigorSwitch PX2060

### New Features

- None.

### Improvement

- Improved: Improve the CGI security.
- Improved: Incorporating the security patches to OpenSSL.
- Improved: Add support for including the device hostname in DHCP Option 12 when sending DHCP requests.
- Corrected: An issue with the power-up delay for PoE devices (e.g., VigorAP 1070C).
- Corrected: An issue where a DHCP Server IP interface with the Pool Count set to 1021 generated an error and could not be saved.
- Corrected: An issue where the switch rebooted when clearing the Protected Host Table while the MAC table contained a large number of entries.
- Corrected: An issue where stale MAC/ARP entries remained on the L3 switch after an HA VIP failover, causing traffic to be forwarded to the previously active node.
- Corrected: An issue where intermittent L3 VLAN routing failures caused end devices to lose connectivity under high network load when using the switch as their default gateway.

### Known Issue

- None.